

Form 3400-11  
(September 1967)  
(formerly 4-683)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

Mineral Survey number  
4690

State  
Arizona

Land District  
Arizona

FIELD NOTES

Of the Survey of the Mining Claim of *(name and address of Claimant)*

Superior Companies, Inc.  
P. O. Box 6497  
Phoenix, Arizona 85005

Known as the *(name of group, if any)*

CONSISTING OF LOCATIONS NAMED AND LOCATED AS FOLLOWS

NAME OF LOCATION	DATE	
	LOCATED	AMENDED
The Fisher Enterprises, Inc. Mill Site No. 1	4/11/69	
The Fisher Enterprises, Inc. Mill Site No. 2	"	
The Fisher Enterprises, Inc. Mill Site No. 3	"	
The Fisher Enterprises, Inc. Mill Site No. 4	"	

16

Mining district Harcuvar			County Yuma	
Section 24	Township 6 N.	Range 12 W.	Meridian G&SR	Survey under order dated April 23, 1971
Survey commenced May 4, 1971		Survey completed May 5, 1971	Name of Mineral Surveyor Harvey W. Smith	

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

WATER RIGHTS

Section	
Range	
County	
State	

1. The following is a list of the water rights which are owned by the United States in the above described section, range and county, and which are subject to the provisions of the Act of March 3, 1879, (22 Stat. 496), and the Act of August 9, 1917, (40 Stat. 1052), and the Act of August 10, 1937, (50 Stat. 1069), and the Act of August 10, 1937, (50 Stat. 1069), and the Act of August 10, 1937, (50 Stat. 1069).

Section	
Range	
County	
State	

FEET

This survey was made with a Swiss Kern theodolite, Model DKM 1, No. 77769, having horizontal and vertical circles, 50 mm. in diam. The circles are graduated in degrees and 20-minute increments. An optical micrometer, adjustable to the vertical and horizontal circles, permits the reading of angles direct to ten seconds' accuracy and estimating to one-second accuracy. The instrument was in good condition at the time of the survey, and all adjustments were in good order.

All azimuths in this record were determined by the method of horizontal-angles-right referred to the meridian established by direct observation on the sun. At 9:28 a.m. on May 4, 1971, at Cor. No. 4 of The Fisher Enterprises, Inc. No. 4 Mill Site latitude  $33^{\circ} 50' 28.8''$  N., longitude  $113^{\circ} 27' 28.6''$  W., turning from a reference point about 1300 ft. northwesterly clockwise to the sun in a southeasterly direction.

True bearing of reference point: N.  $22^{\circ} 36'$  W.

The lines were measured with a Lufkin steel tape, 300 ft. in length, graduated every foot for 299 ft. and the remaining foot graduated to tenths and hundredths. One additional foot at the zero end is also graduated in tenths and hundredths. The tape was compared to a standard and found to be correct. All lines and connections of this survey were run by direct methods.

The magnetic declination observed at each corner of the survey gave a uniform value of  $14^{\circ} 00'$  E.

---

SURVEY NO. 4690

---

THE FISHER ENTERPRISES, INC. MILL SITE NO. 1

At Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 1, identical with Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 2 of this survey, on the south R/W line of U. S. Highway 60 and 70 and in center of unimproved access road bearing NW. and SE.

Fd. an iron post, 2 ins. diam., flush with the ground, with aluminum cap mkd. 1-1-2-1 U.S.M.M.S. - 4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 11 T.F.E.I. M.S. 21X; from which

The cor. of Secs. 19, 24, 25 & 30, T. 6 N., Rs. 11 & 12 W., G&SRM, bears S.  $38^{\circ} 48' 45''$  E. 2580.07 ft. dist., a stone, 7 x 8 ins., 4 ins. above ground, firmly set, marked and witnessed as described in the official record.

FEET		
660.0	<p style="text-align: center;">Thence S. 22° 36' E.</p> <p>Cor. No. 2, identical with Cor. No. 4 of The Fisher Enterprises, Inc., Mill Site No. 2, Cor. No. 2 of The Fisher Enterprises, Inc. Mill Site No. 3 and Cor. No. 2 of The Fisher Enterprises, Inc. Mill Site No. 4, all of this survey.</p> <p>Fd. an iron post, 2 ins. diam., flush with the ground, with aluminum cap mkd. 1-2-2-4-3-2-4-2 U.S.M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 1 2 T.F.E.I. M.S. 2 4 T.F.E.I. M.S. 3 2 T.F.E.I. M.S. 4 2X.</p>	
330.0	<p style="text-align: center;">Thence S. 67° 24' W.</p> <p>Cor. No. 3, identical with Cor. No. 3 of The Fisher Enterprises, Inc. Mill Site No. 4, of this survey.</p> <p>Fd. an iron post, 2 ins. diam., 3 ins. above the ground, with aluminum cap mkd. 1-3-4-3-U.S.M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 1 3 T.F.E.I. M.S. 4 3X.</p>	
660.0	<p style="text-align: center;">Thence N. 22° 36' W.</p> <p>Cor. No. 4, on the south R/W line of U. S. Highway 60 and 70.</p> <p>Fd. an iron post, 2 ins. diam., 10 ins. above the ground, with aluminum cap mkd. 1-4 U.S.M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 1 4X.</p>	
248.	<p style="text-align: center;">Thence N. 67° 24' E.</p> <p>Power line, bears NW. and SE.</p>	
330.0	<p>Cor. No. 1, and place of beginning.</p>	
	<hr/> <p style="text-align: center;"><b>THE FISHER ENTERPRISES, INC. MILL SITE NO. 2</b></p> <p>Beginning at Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 2, identical with Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 1 of this survey.</p>	
330.0	<p style="text-align: center;">Thence N. 67° 24' E.</p> <p>Cor. No. 2, on the south R/W line of U. S. Highway 60 and 70.</p> <p>This corner falls in mud filled ditch and was not set.</p>	

FEET	
	Thence S. 22°36' E.
25.0	Witness for Cor. No. 2.  Fd. an iron post, 2 ins. diam., 10 ins. above the ground, with aluminum cap mkd. W.C. 2-2 U.S.M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 22 W.C.X.
660.0	Cor. No. 3, identical with Cor. No. 3 of The Fisher Enterprises, Inc. Mill Site No. 3 of this survey.  Set an iron post, 3/4 in. diam., 20 ins. long, in a 25 pound concrete rock base, 10 ins. in the ground, with a brass cap firmly secured to the iron post, mkd. M.S. 4690 T.F.E.I. M.S. 23 T.F.E.I. M.S. 3 3X;
	Thence S. 67°24' W.
330.0	Cor. No. 4, identical with Cor. No. 2 of The Fisher Enterprises, Inc. Mill Site Nos. 1, 3 and 4 of this survey.  Thence N. 22°36' W.
660.0	Cor. No. 1, and place of beginning.
THE FISHER ENTERPRISES, INC. MILL SITE NO. 3	
	At Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 3, identical with Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 4 of this survey.  Fd. an iron post, 2 ins. diam., 4 ins. above the ground, with aluminum cap mkd. 3-1-4-1 U.S.M. M.S.-4611, to which I add mks. M.S. 4690 T.F. E.I. M.S. 3 1 T.F.E.I. M.S. 4 1X; from which
	The cor. of secs. 19, 24, 25 & 30, T. 6 N., Rs. 11 & 12 W., G&SRM, bears S. 54°29'45" E., 1363.30 ft. dist., previously described.  Thence N. 22°36' W.
660.0	Cor. No. 2, identical with Cor. No. 2 of The Fisher Enterprises, Inc. Mill Site Nos. 1 and 4, and Cor. No. 4 of The Fisher Enterprises, Inc. Mill Site No. 2, all of this survey.  Thence N. 67°24' E.
330.0	Cor. No. 3, identical with Cor. No. 3 of The Fisher Enterprises, Inc. Mill Site No. 2 of this survey.  Thence S. 22°36' E.
660.0	Cor. No. 4.

(This form bound on left side)

FEET	
	<p>Fd. an iron post, 2 ins. diam., 10 ins. above the ground, with aluminum cap mkd. 3-4 U.S. M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 3 4X.</p> <p style="text-align: center;">Thence S. 67<sup>0</sup>24' W.</p>
205.	Road, bears N. 40 <sup>0</sup> W. and S. 40 <sup>0</sup> E.
330.0	Cor. No. 1 and place of beginning
<hr/> <p>THE FISHER ENTERPRISES, INC. MILL SITE NO. 4</p>	
	<p>Beginning at Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 4, identical with Cor. No. 1 of The Fisher Enterprises, Inc. Mill Site No. 3 of this survey.</p> <p style="text-align: center;">Thence N. 22<sup>0</sup>36' W.</p>
660.0	Cor. No. 2, identical with Cor. No. 2 of The Fisher Enterprises, Inc. Mill Site Nos. 1 and 3, and Cor. No. 4 of The Fisher Enterprises, Inc. Mill Site No. 2, all of this survey.
	Thence S. 67 <sup>0</sup> 24' W.
330.0	Cor. No. 3, identical with Cor. No. 3 of The Fisher Enterprises, Inc. Mill Site No. 1 of this survey.
	Thence S. 22 <sup>0</sup> 36' E.
660.0	Cor. No. 4.
	<p>Fd. an iron post, 2 ins. diam., 10 ins. above the ground, with aluminum cap mkd. 4-4 U.S. M.M.S.-4611, to which I add mks. M.S. 4690 T.F.E.I. M.S. 4 4X.</p> <p style="text-align: center;">Thence N. 67<sup>0</sup>24' E.</p>
330.0	Cor. No. 1, and place of beginning.
<hr/> <p>SURVEY NO. 4690</p>	
<p>AREAS</p>	
	<p><u>Acres</u></p>
	<p>Total area, The Fisher Enterprises, Inc. Mill Site No. 1 ----- 5.000</p> <p style="padding-left: 2em;">Area in conflict with --</p> <p>U.S. Marble Mill Site #1 Sur. No. 4611-- 5.000</p> <p>Total area, The Fisher Enterprises, Inc. Mill Site No. 2 ----- 5.000</p> <p style="padding-left: 2em;">Area in conflict with --</p> <p>U.S. Marble Mill Site #2 Sur. No. 4611--- 5.000</p> <p>Total area, The Fisher Enterprises, Inc. Mill Site No. 3 ----- 5.000</p> <p style="padding-left: 2em;">Area in conflict with --</p> <p>U.S. Marble Mill Site #3 Sur. No. 4611--- 5.000</p>

6

	FEET		Acres
		Total area, The Fisher Enterprises, Inc. Mill Site No. 4 -----	5.000
		Area in conflict with -- U.S. Marble Mill Site #4 Sur. No. 4611 ---	5.000
		LOCATION	
		This survey is located in the SE $\frac{1}{4}$ of Sec. 24, T. 6 N., R. 12 W., G&SRM.	
		The survey of The Fisher Enterprises, Inc. Mill Sites Nos. 1, 2, 3 and 4 is identical with the respective locations as marked on the ground.	
		IMPROVEMENTS	
		The improvements made upon or for the benefit of each of the locations embraced in said Mill Sites by the claimant or its grantors are as follows:	
		From Cor. No. 4, The Fisher Enterprises, Inc. Mill Site No. 2:	
No. 1		A steel bin, 9 x 9 ft., 14 ft. deep, the South corner of which bears N. 16° E., 80 ft. dist.; West side bears N. 38° W.	
No. 2		A crusher, 3 x 3 ft., bears N. 10° E., 84 ft. dist.	
No. 3		A conveyor belt, 30 ins. wide, bears North 115 ft. dist.; lengthwise bears N. 38° W. - S. 38° E.	
No. 4		A crusher, 4 x 20 ft., the South end of which bears N. 8°30' W., 141 ft. dist.; lengthwise, bears N. 38° W.	
No. 5		A steel elevator, 3 x 3 ft., 24 ft. high, the West corner of which bears N. 12°30' W., 162 ft. dist.	
No. 6		A steel bin,, 14 x 14 ft., 14 ft. high, the East corner of which bears N. 1°45' W., 171 ft. dist.; East side bears N. 36° W.	
No. 7		A sheet metal building, 20 x 28 ft., South corner of which bears N. 15°30' W., 205 ft. dist.; West side bears N. 36° W., 28 ft. Inside is a steel bin, 10 x 10 ft.	
		From Corner No. 3, The Fisher Enterprises, Inc. Mill Site No. 2:	
No. 8		A steel tumbler, 6 ft. diam., 18 ft. long, the South end of which bears N. 77° W., 338 ft. dist., lengthwise, bears N. 35° W.	
No. 9		A 4 in. well, 640 ft. deep, bears N. 71°50' W., 256 ft. dist.	

FEET					
	From Cor. No. 1, The Fisher Enterprises, Inc. Mill Site No. 2:				
No. 10	A frame building, 30 x 40 ft., the Northwest corner of which bears due East, 150 ft. dist.; the West side bears S. 22°36' E., 40 ft.				
No. 11	A work shop, steel and concrete, open on the south end, the NE. cor. of which bears S. 23° W., 151 ft. 73 x 41 ft., the long sides bear S. 20° E.				
	OTHER CORNER DESCRIPTIONS AND SUPPLEMENTAL DATA				
	The locations and corners of The Fisher Enterprises, Inc. Mill Sites Nos. 1, 2, 3 and 4 of this survey are identical with the locations and corners of the U.S. Marble Mill Sites #'s 1, 2, 3 and 4, surveyed under Mineral Survey No. 4611, approved December 5, 1963. All lines were found to be correct as approved, except for the following:				
	From Cor. 1 of the U. S. Marble Mill Site #1, identical with Cor. 1 of the U.S. Marble Mill Site #2, the cor. of secs. 19, 24, 25 and 30, bears S. 38°48'45" E., 2580.07 ft. instead of S. 38°51' E., 2581.1 ft., as approved; and from Cor. 1 of the U.S. Marble Mill Site #3, identical with Cor. 1 of the U.S. Marble Mill Site #4, the cor. of secs. 19, 24, 25 and 30, bears S. 54°29'45" E., 1363.30 ft. instead of S. 54°33' E., 1364.7 ft., as approved.				
	FIELD ASSISTANTS				
	<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left; border-bottom: 1px solid black;">Name</th> <th style="text-align: left; border-bottom: 1px solid black;">Capacity</th> </tr> </thead> <tbody> <tr> <td>George Erickson</td> <td>Chainman-Axeman</td> </tr> </tbody> </table>	Name	Capacity	George Erickson	Chainman-Axeman
Name	Capacity				
George Erickson	Chainman-Axeman				



UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

CERTIFICATE OF SURVEYOR

Name of Mineral Surveyor <b>Harvey W. Smith</b>	Date <b>5/6/71</b>
--	-----------------------

I HEREBY CERTIFY That in pursuance of an order received from the **Bureau of Land Management**, at **Phoenix, Arizona**, dated **April 23**, 1971, I have carefully executed the survey of the claim of **Superior Companies, Inc.** known as the ~~United States~~ mill site) **The Fisher Enterprises, Inc. Mill Sites Nos. 1, 2, 3 & 4**, situated in **Sec. 24**, Township **6 N.**, Range **12 W.**, **G&SR** Meridian, in the State of **Arizona**.

This survey, designated as number **4690**, has been executed by me and under my direction and has been made in strict conformity with said order, the Manual of Instructions for the Survey of Public Lands of the United States, and in specific manner described in the foregoing field notes.

I FURTHER CERTIFY That the labor expended and improvements made upon and for the benefit of the ~~United States~~ **Mill Site** location(s) embraced in the said mining claim by claimant(s) or **its** grantors are fully stated in my report. The character, extent, location, and itemized value are specified in full detail. No portion of, or interest in, said labor and improvements so credited to this claim has been included in the estimate of expenditures upon any other claim.

**Paradise Valley, Arizona**  
(Location)

*Harvey W. Smith*  
(Signature of Mineral Surveyor)

CERTIFICATE OF APPROVAL BUREAU OF LAND MANAGEMENT

Office <b>Arizona State Office</b>
Location <b>Phoenix, Arizona</b>
Date <b>June 16, 1971</b>

The foregoing field notes of mineral survey number **4690**, in **Section 24**, Range **12 W.**, **Gila & Salt River** Meridian, in the State of **Arizona**, Township **6 N.**, executed by **Harvey W. Smith**, Mineral Surveyor, under order dated **April 23**, 1971, having been critically examined and the necessary corrections made prior to their certification by the surveyor, the field notes and the survey therein described are hereby approved.


*Joe T. Fullini*  
(Authorized Signature) **State Director**  
(Title)

~~CERTIFICATE OF TRANSCRIPT~~

~~I HEREBY CERTIFY That the foregoing transcript of field notes of the above described mineral survey number is a true copy of the original field notes.~~

~~(Authorized Signature) (Title)~~

~~Title 18, U.S.C. section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious, or fraudulent statements or representations as to any matter within its jurisdiction.~~

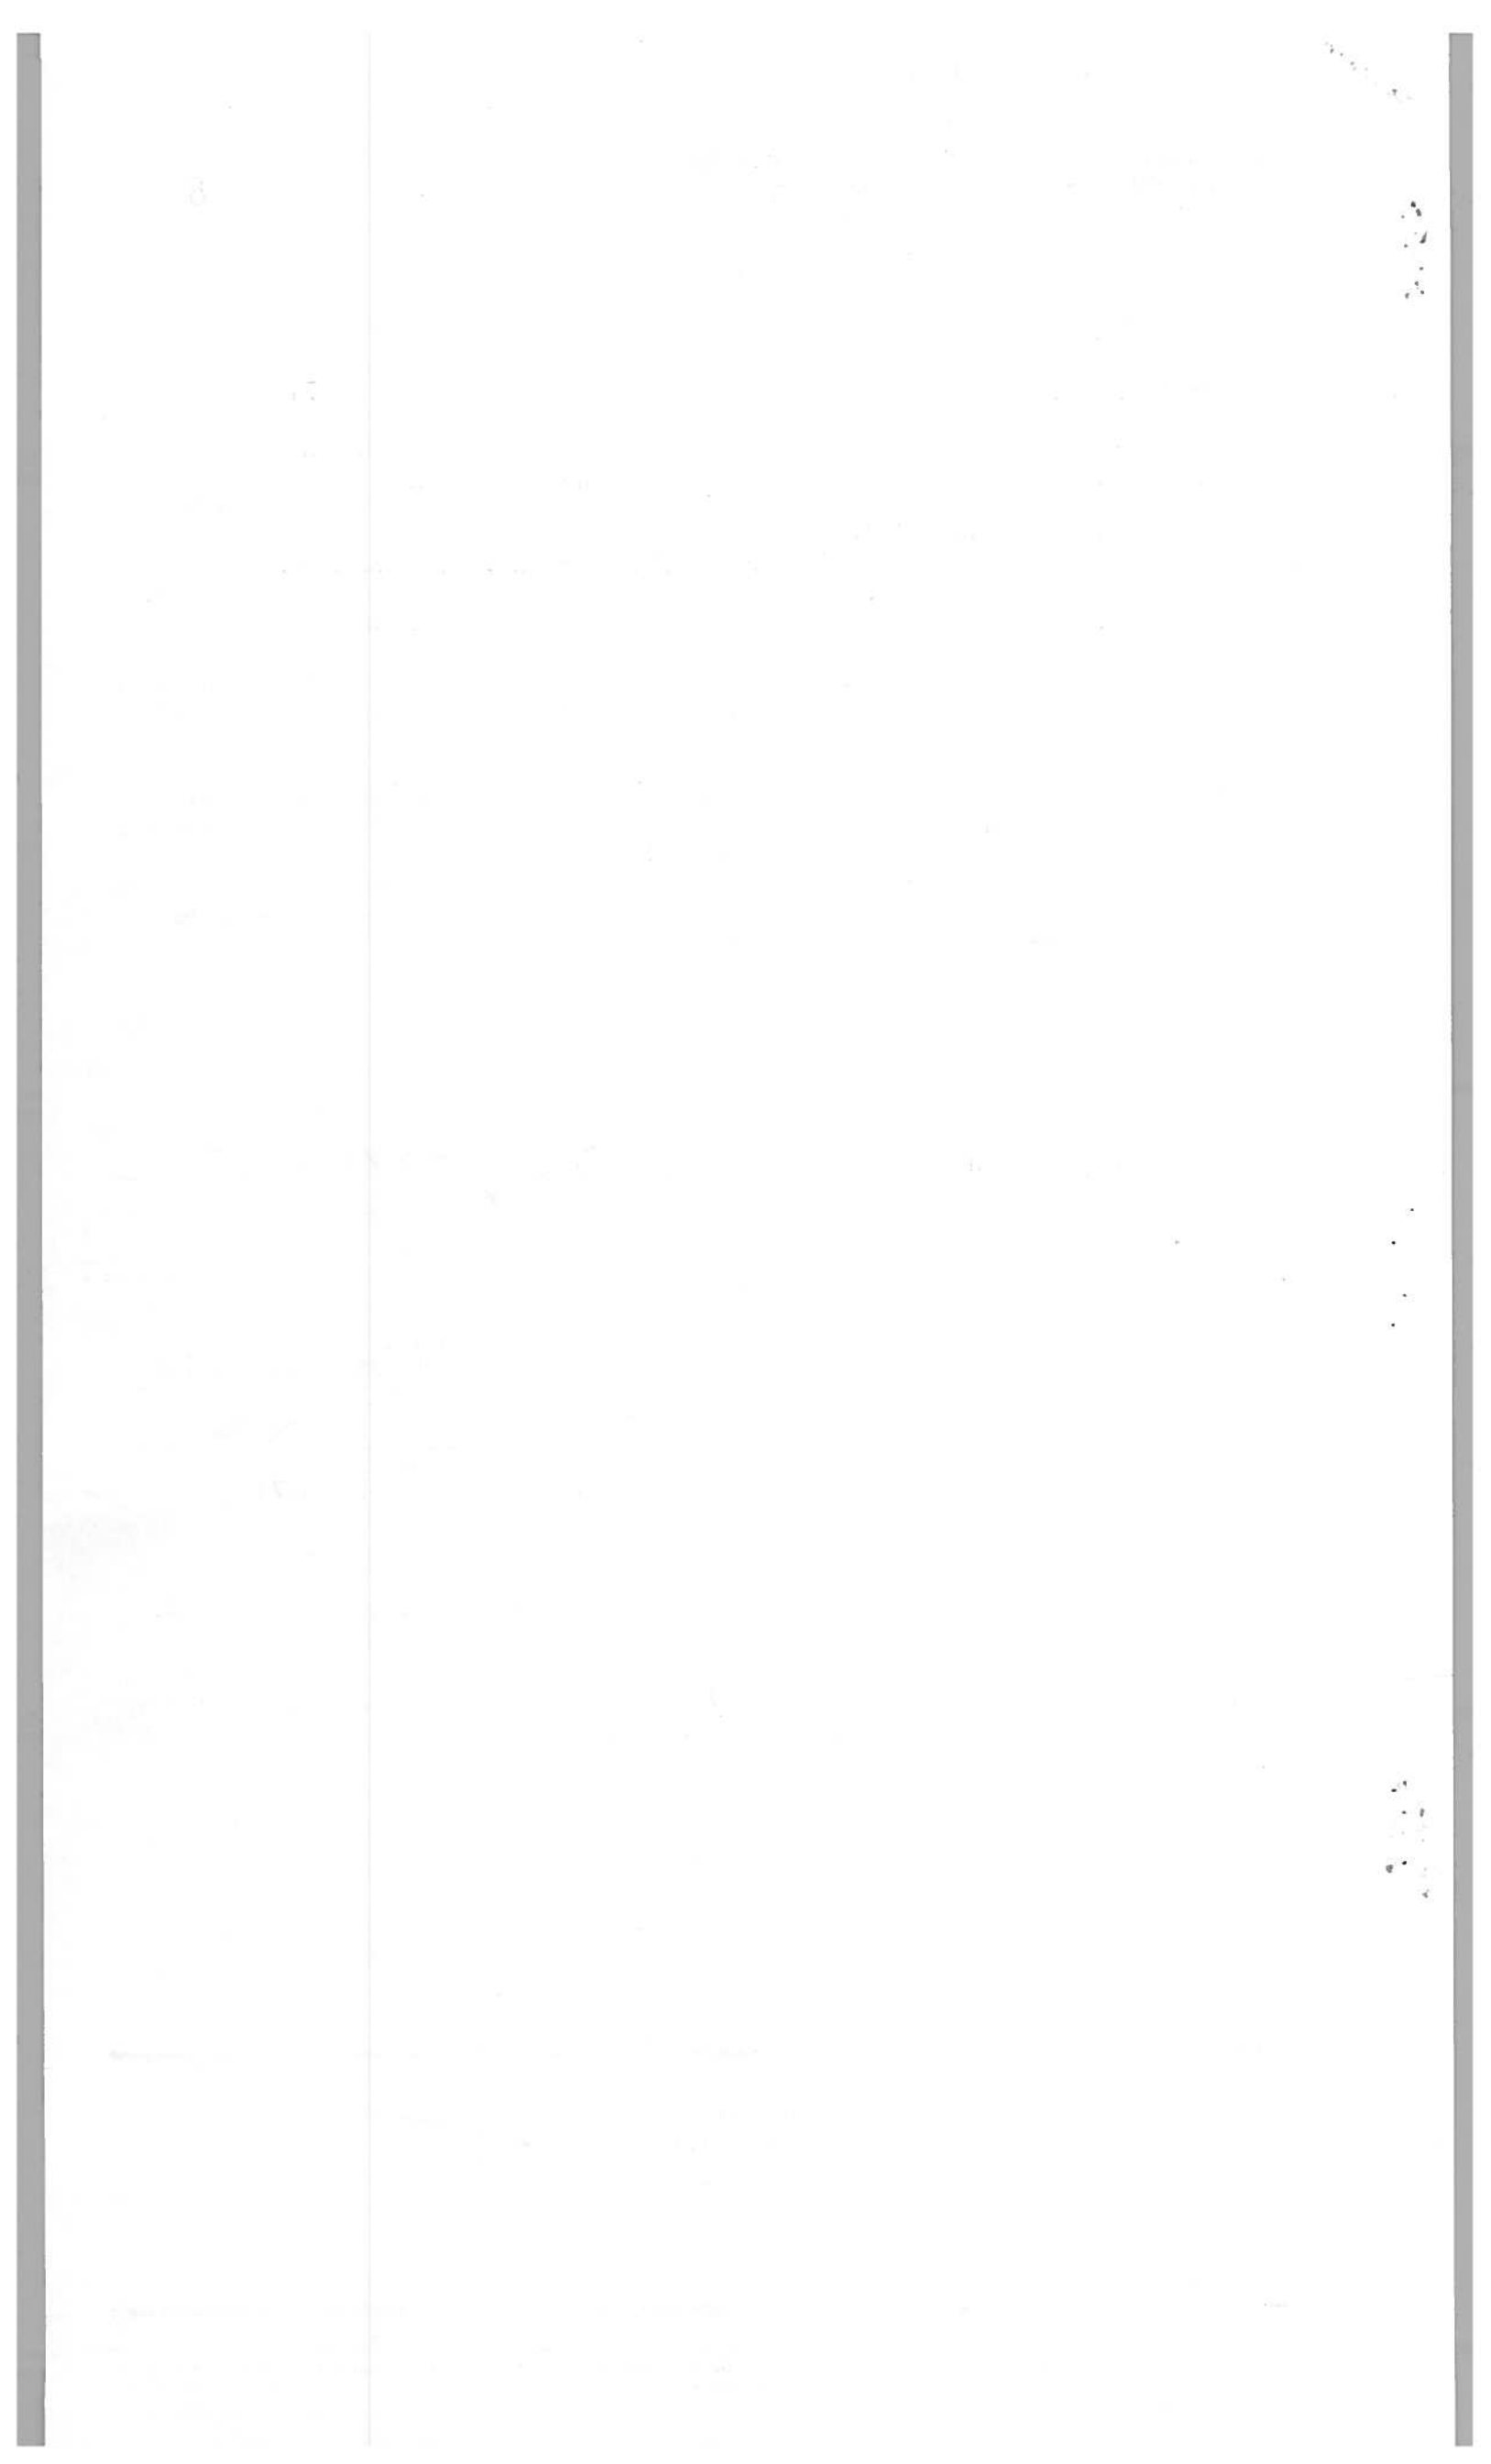

UNITED STATES DEPARTMENT OF THE INTERIOR 9605 (956)  
BUREAU OF LAND MANAGEMENT M.S. 4690  
ARIZONA STATE OFFICE

---

NOTICE OF CANCELLATION OF MINERAL SURVEY

The Fisher Enterprises, Inc. Mill Site No. 1, The Fisher Enterprises, Inc. Mill Site No. 2, The Fisher Enterprises, Inc. Mill Site No. 3 and The Fisher Enterprises, Inc. Mill Site No. 4, Mineral Survey No. 4690, located in section 24, Township 6 North, Range 12 West, Gila and Salt River Meridian, Arizona, are hereby canceled.


These claims have not been filed with the Arizona State Office, Bureau of Land Management, in accordance with Section 314, 90 STAT. 2769, (43 U.S.C. 1744).

This cancellation was necessitated to clear the record.

The Mineral Survey Plat should be noted as follows:

"The Fisher Enterprises, Inc. Mill Site No. 1, The Fisher Enterprises, Inc. Mill Site No. 2, The Fisher Enterprises, Inc. Mill Site No. 3 and The Fisher Enterprises, Inc. Mill Site No. 4, M.S. 4690, were canceled March 25, 2002, by memo 9605 (956) M.S. 4690, which is now a part of the original field notes."

March 25, 2002  
Date

  
\_\_\_\_\_  
Chief Cadastral Surveyor of Arizona

