ORIGINAL BOOK 5282

R.5282

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FIELD NOTES OF THE

	CORRECTIVE DEPENDENT RESURVEY OF
A P	ORTION OF THE EAST BOUNDARY AND SUBDIVISIONAL LINES
	AND THE CORRECTIVE SURVEY OF SUBDIVISION
	IN SECTIONS 13, 21 AND 29
	AND THE CORRECTIVE METES-AND-BOUNDS SURVEY
	OF TRACTS 37 AND 38 AND A PORTION OF TRACT 39,
	TOWNSHIP 4 NORTH, RANGE 4 WEST
Of the	Gila and Salt River Meridian,
In the State of	
	EXECUTED BY
DUANE R. GARO	UTTE , Cadastral Surveyor
PAUL L. REEVE	S , Cadastral Surveyor
	ructions dated <u>November 8</u> , 1985, approved <u>November 8,</u> 1985 pecial instructions dated and approved November 25, 1986,
and second supplem	ental special instructions dated and approved December 19, 1986,
	, which provided for the surveys included under Group Number
674 and as	signment instructions dated <u>November 25</u> , 1986.
	Survey commenced <u>December 1</u> , 1986
	Survey completed February 18 , 1987

INDEX DIAGRAM

TOWNSHIP 4 NORTH , RANGE 4 WEST

6	5	4	3	2	1
7	8	9	10	11	12
18	17	16	15	14	13
19	20	21	22	23	24
30	29 .4	28	27	26	25
31	32	33	34	35	36

Subdivision of Section 13 pp. 18
Subdivision of Section 21 pp. 19
Subdivision of Section 29 pp. 21
Survey of Tract 37 PP. 23
Survey of Tract 38 PP. 27
Survey of Tract 39 PP. 29

T 4 N, R 4 W, Gila and Salt River Mer., Arizona

CHAINS

The following field notes describe the corrective dependent resurvey of a portion of the east boundary and subdivisional lines and the corrective survey of subdivisions in sections 13, 21 and 29 and the corrective metes-and-bounds survey of Tracts 37 and 38 and a portion of Tract 39 in Township 4 North, Range 4 West, Gila and Salt River Meridian, Arizona.

The history of surveys pertaining to this survey is as follows:

The east boundary was surveyed by Roy J. Gill in 1915. The subdivisional lines were surveyed by H. D. Voigt and Roy J. Gill in 1915-16. A portion of the east boundary and subdivisional lines were resurveyed, and sections 13, 21 and 29 subdivided, and Tracts 37, 38 and 39 were surveyed by Paul L. Reeves and Stephen J. Malloy in 1985-86.

The survey was executed in accordance with the specifications as set forth in the Manual of Surveying Instructions, 1973, and the Special Instructions dated November 8, 1985, and the Supplemental Instructions dated November 25, 1986, and the Second Supplemental Instructions dated December 19, 1986, for Group No. 674, Arizona.

Preliminary to the survey, certain lines of the 1985-86 survey were retraced and the positions of the monuments were evaluated. It was determined that collateral evidence furnished by the Bureau of Reclamation was not used in 1985-86 to reestablish lost corners, and certain monuments were erroneously located, necessitating this corrective survey. The retracement data were thoroughly verified and only the true line field notes are given herein.

The directions of all lines were determined by observations on a U.S.C.& G.S. triangulation network and refer to the true meridian. Distances and angles were measured with a Hewlett-Packard 3820 total station.

The geographic position of the southeast corner of section 13, as shown on the official plat of T 4 N, R 4 W accepted March 3, 1986, is as follows:

NAD 27: Latitude: 33°40'56.2" N Longitude: 112°36'27.7" W

The mean magnetic declination as shown on the 1986 official plat is 14° E.

Corrective Dependent Resurvey of a Portion of the East Boundary, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	Correction of the Dependent Resurvey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86
	Beginning at the cor. of secs. 13, 18, 19, and 24, on the E bdy. of the Tp., monumented with an iron post, 3 ins. diam., firmly set, projecting 7 ins. above ground, with brass cap mkd.
	T4N
	R4W R3W S13 S18
	S24 S19 1915
:	The cor. is located in a fence, bears N and S.
	N 0°01' E, bet. secs. 13 and 18.
	Over nearly level land, along fence.
24.745	AP 4A, Tract 37, on the southerly right-of-way line of the C.A.P. Canal, hereinafter described. The cor. is located 2 lks. S of corner of fences extending N 69° E, S 69° W and S.
	Continue on the line bet. secs. 13 and 18, on line 4A-1, Tract 37.
37.715	AP 1, Tract 37, on the northerly right-of-way line of the C.A.P. Canal, hereinafter described. The cor. is located at corner of fences extending N, N 69° E and S 69° W.
	Continue on the line bet. secs. 13 and 18.
	Along fence.
40.035	The 1/4 sec. cor. of secs. 13 and 18, monumented with an iron post, 1 in. diam., firmly set, projecting 18 ins. above ground, with brass cap mkd.
	1/4 S13 S18 1915
	The cor. is located at corner of fences extending S and W.
1	

Corrective Dependent Resurvey of a Portion of the Subdivisional Lines,


Correction of a Portion of the Dependent Resurvey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86 From the 1/4 sec. cor. of secs. 23 and 24, monumented with an iron post, 1 in. diam., firmly set, projecting 18 ins. above ground, with brass cap mkd. 1/4 S23 S24 1915 N 0°01' W, bet. secs. 23 and 24. Over nearly level land.
iron post, 1 in. diam., firmly set, projecting 18 ins. above ground, with brass cap mkd. 1/4 S23 S24 1915 N 0°01' W, bet. secs. 23 and 24.
S23 S24 1915 N 0°01' W, bet. secs. 23 and 24.
Over nearly level land.
AP 3A, Tract 38, on the southerly right-of-way line of the C.A. Canal, hereinafter described.
NOTE: After consultation with personnel from the Bureau of Reclamation the southerly right-of-way line at this point is determined by reference to the map furnished by the Bureau of Reclamation and not by the monumentation on the ground.
Continue on the line bet. secs. 23 and 24, on line 3A-2A, Tract 38.
Intersect a line of Bureau of Reclamation markers, hereinafter described. These markers were not used to determine the southerly right-of-way line.
True point for the cor. of secs. 13, 14, 23, and 24, determined at a calculated position from Bureau of Reclamation sta. 300+00.39 R.O.W. 300 FT. RT. using the Reclamation's field data falls in the C.A.P. Canal where it is impracticable to establis a permanent monument.
This point now also functions as AP 2A, Tract 38.
From this point the 1985-86 proportioned position bears N 78°00' E, 10 lks. dist.
From this same point the Bureau of Reclamation marker, bears S 53°30' E, 4.716 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 300+00.39 R.O.W. 300 FT. RT. R-8.

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	From this same point the witness cor. for the cor. of secs. 13, 14, 23, and 24, bears N 6°43' W, 3.12 chs. dist., (1985-86 Record: N 8°33' W, 3.113 chs.) monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. A steel fence post is near the cor. Add the marks 1987 on the brass cap.
	From the 1/4 sec. cor. of secs. 13 and 24, monumented with an iron post, 1 in. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.
	1/4 <u>S13</u> S24 1915
	S 89°59' W, bet. secs. 13 and 24.
	Over nearly level land.
24.625	AP 1A, Tract 38, on the southerly right-of-way line of the C.A.P Canal, hereinafter described.
	Continue on the line bet. secs. 13 and 24, on line 1A-2A, Tract 38.
40.00	The true point for the cor. of secs. 13, 14, 23, and 24, identical with AP 2A, Tract 38.
	N 0°01' E, bet. secs. 13 and 14.
	Over nearly level land.
40.03	The 1/4 sec. cor. of secs. 13 and 18, monumented with an iron post, 1 in. diam., firmly set, projecting 19 ins. above ground, with brass cap mkd.
	1/4 S14 S13 1915
:	The cor. is located at a gate in a fence, bears E and W.

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	From the true point for the cor. of secs. 13, 14, 23, and 24, identical with AP 2A, Tract 38.
	S 89°55' W, bet. secs. 14 and 23.
	Over nearly level land.
39.895	The 1/4 sec. cor. of secs. 14 and 23, monumented with an iron post, 1 in. diam., firmly set, projecting 18 ins. above ground, with brass cap mkd.
	$1/4 \frac{S14}{S23}$
	1916
	1910
	From the 1/4 sec. cor. of secs. 22 and 23, monumented with an iron post, 1 in. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.
	1/4
	\$22 \$23
	1916
	The cor. is located in a fence, bears N and S.
	N 0°01' W, bet. secs. 22 and 23.
	Over nearly level land; a fence is along a portion of this line.
4.05	A plastic cap attached to a local monument and mkd. CTS ENG RLS 15909.
7.095	Point for AP 47A, Tract 39, determined by the position of AP 47 set in 1985.
	From this point the 1985 monument, bears S 89°33' E, 2.5 lks. dist., an aluminum finned post, 3/4 in. diam., set 12 ins. below surface of a road bearing N and S, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
	Remove the aluminum finned post from the found position and being twisted and bent is impracticable to reuse so it is destroyed.
	At the cor. point

CHAINS

Set an aluminum finned post, 36 ins. long, 3/4 in. diam., 8 ins. below surface of road, with cap mkd.

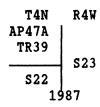

from which

- A reference monument, an aluminum post, 3/4 in. diam., firmly set, projecting 6 ins. above ground, bears S 67°58' E, 34.3 ft. dist. Change the marks to read RM T4N R4W AP 47A 34.3 FT. S23 1985 1987 and an arrow pointing to the cor.
- A reference monument, an aluminum post, 3/4 in. diam., firmly set, projecting 8 ins. above ground, bears S 66°32' W, 34.6 ft. dist. Change the marks to read RM T4N R4W AP 47A 34.6 FT. S22 1985 1987 and an arrow pointing to the cor.

From this cor. a rebar, 1/2 in. diam., flush with the ground, with attached plastic cap mkd. CTS ENG RLS 15909, bears S 89°33' E, 50 lks. dist.

From this same cor. a Bureau of Reclamation right-of-way marker, bears N 89°33' W, 36.835 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 220+00.10 R.O.W. 125 FT. RT. R-8.

Continue on the line bet. secs. 22 and 23, on line 47A-1, Tract 39.

AP 1, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, flush with the ground, with brass cap mkd.

The cor. is located at a gate in a fence, bears N and S.

Corrective Dependent Resurvey of a Portion of the Subdivisional Lines,

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona		
CHAINS	2 4 M, M 3 W, GIIA AND DAIL RIVEL MEL., MIIZONA		
	Continue on the line bet. secs. 22 and 23.		
39.99	The cor. of secs. 14, 15, 22, and 23, monumented with an iron post, 2 ins. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.		
	T4N R4W S15 S14		
	S22 S23 1916		
	The cor. is located in a fence, bears N and S.		
	From the cor. of secs. 20, 21, 28, and 29, monumented with an iron post, 2 ins. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.		
	T4N R4W S20 S21		
	S29 S28 1916		
	N 0°02' W, bet. secs. 20 and 21.		
	Over gently rolling land.		
37.28	Point for a witness point on the southerly right-of-way line of the C.A.P. Canal, determined by the position of the witness point set in 1985.		
	From this point the 1985 monument, bears S 56°37' W, 1.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 3 ins. above ground.		
l	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.		
ļ			

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	W P T4N R4W TR 39 \$20 \$21 1987 1985
	Deposit the same magnet in a 1 \times 1 \times 2 5/8 in. white colored plastic case beneath the stainless steel post.
40.02	True point for the 1/4 sec. cor. of secs. 20 and 21, determined at a calculated position from Bureau of Reclamation sta. P.T. 139+68.18 R.O.W. 125 FT. RT. using the Reclamation's field data, falls in the C.A.P. Canal where it is impracticable to establish a permanent monument.
	From this point the 1985 proportioned position bears N 49°00' W, 1.5 lks. dist.
	From this same point the Bureau of Reclamation marker, identical with AP 40, Tract 39, bears S 65°03' E, 2.688 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 40 TR 39 P.T. 139+68.18 R.O.W. 125 FT. RT. R-8.
	N 0°03' W, beginning new measurement.
6.32	Point for AP 15A, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, determined by the position of AP 15 set in 1985.
	From this point AP 15, monumented in 1985, bears S 44°06' W, 1.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 22 ins. in the ground, remark the brass cap to read.
	T4N R4W S20 AP15A TR39 1987 1985

CHAINS

Deposit the same magnet in a $1 \times 1 \times 2 = 5/8$ in. white colored plastic case beneath the stainless steel post.

Set a steel fence post near the cor.

From this cor. AP 16, Tract 39, bears S 44°06' W, 39.35 chs. dist., monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 16 TR 39 115+43.56 R.O.W. 175 FT. LT. R-8.

Continue on the line bet. secs. 20 and 21, on line 15A-14, Tract 39.

33.255

AP 14, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, occupied by the 1985 monument, a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.

A steel fence post is near the cor.

From this cor. AP 13, Tract 39, bears S 82°14' E, 22.69 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. A steel fence post is near the cor.

Continue on the line bet. secs. 20 and 21.

40.05

The cor. of secs. 16, 17, 20, and 21, monumented with an iron post, 2 ins. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.

T4N S17	R4W S16	
S20	S21	
1916		

CHAINS			

From the cor. of secs. 29, 30, 31, and 32, monumented with an iron post, 2 ins. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.

T4N	R4W
S30	S29
S31	\$32
191	6

N 89°52' W, bet. secs. 30 and 31.

Over gently rolling land.

- 22.70 A local monument established by the Bureau of Reclamation in 1976, on line, a wooden hub, 2 x 2 ins., flush with the ground.
- Point for a witness point on the southerly right-of-way line of the C.A.P. Canal determined by the position of the witness point set in 1985.

From this point the 1985 monument, bears S 7°11' W, 2 lks. dist., an aluminum finned post, 3/4 in. diam., firmly set, projecting 4 ins. above ground.

Remove the aluminum finned post, 36 ins. long, from the found position and reset it at the correct position, 30 ins. in the ground, remark the cap to read.

A steel fence post is near the cor.

Point for the 1/4 sec. cor. of secs. 30 and 31, determined at a calculated position from a Bureau of Reclamation 2 x 2 hub and tack, on line bet. secs. 30 and 31, using the Reclamation's field data, falls on large fill.

CHAINS

From this point the 1985 proportioned position bears S 45°00' W, 4 lks. dist., monumented with an aluminum finned post, 3/4 in. diam., loosely set, projecting 12 ins. above ground, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.

Remove the aluminum finned post from the found position and being twisted and bent is impracticable to reuse so it is destroyed.

At the corrected cor. point

Set an aluminum finned post, 24 ins. long, 3/4 in. diam., 18 ins. in the ground, with cap mkd.

T4N R4W $1/4 \frac{$30}{$31}$ 1987

A steel fence post is near the cor.

N 89°57' W, beginning new measurement.

10.545

Point for a witness point on the northerly right-of-way line of the C.A.P. Canal determined by the position of the witness point set in 1985.

From this point the 1985 monument, bears S 7°11' W, 2 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 1 in. above ground.

Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 27 ins. in the ground, remark the brass cap to read.

T4N R4W S30 TR39 S31 1987 1985

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	Deposit the same magnet in a 1 \times 1 \times 2 5/8 in. white colored plastic case beneath the stainless steel post.
	A steel fence post is near the cor.
39.72	The cor. of secs. 25, 30, 31, and 36, on the W bdy. of the Tp., (First Guide Meridian West) monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	T4N
	R5W R4W
	\$25 \$30
	\$36 \$31 1985
	1983
	A steel fence post is near the cor.
	From the cor. of secs. 29, 30, 31, and 32.
	N 0°05' E, bet. secs. 29 and 30.
	Over gently rolling land.
32.40	A witness point on the southerly right-of-way line of the C.A.P. Canal, monumented with an aluminum finned post, 3/4 in. diam., firmly set, projecting 6 ins. above ground, with cap mkd.
	W P
	T4N R4W
	TR 39
	\$30 \ \$29
	1985
	A steel fence post is near the cor.

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	From this cor. AP 35, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, bears S 34°55' W, 9.90 chs. dist., monumented with an aluminum finned post, 3/4 in. diam., firmly set, projecting 6 ins. above ground, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
40.05	Point for the 1/4 sec. cor. of secs. 29 and 30, at proportionate dist.; there is no remaining evidence of the original cor.
	From this point the 1985 monument, bears S 88°30' W, 42.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.
	T4N R4W 1/4 S30 S29 1987 1985
	Deposit the same magnet in a 1 \times 1 \times 2 5/8 in. white colored plastic case beneath the stainless steel post.
	Remove the steel fence post and reset it near the cor.
69.535	Point for a witness point on the northerly right-of-way line of the C.A.P. Canal determined by the position of the witness point set in 1985.
	From this point the 1985 monument, bears N 34°55' E, 1.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 24 ins. in the ground, remark the brass cap to read.
	W P T4N R4W S30 S29
1	TR 39

1987 1985

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	Deposit the same magnet in a 1 \times 1 \times 2 5/8 in. white colored plastic case beneath the stainless steel post.
	A steel fence post is near the cor.
80.10	The cor. of secs. 19, 20, 29, and 30, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	T4N R4W S19 S20
	\$30 \$29 1985
	A steel fence post is near the cor.
	From the cor. of secs. 20, 21, 28, and 29.
	WEST, bet. secs. 20 and 29.
	Over gently rolling land.
37.58	Point for a witness point on the southerly right-of-way line of the C.A.P. Canal determined by the position of the witness point set in 1985.
	From this point the 1985 monument, bears S 44°08' W, 4 lks. dist., an aluminum finned post, 3/4 in. diam., firmly set, projecting 6 ins. above ground.
	Remove the aluminum finned post, 36 ins. long, from the found position and reset it at the correct position, 30 ins. in the ground, remark the cap to read.
	W P
	T4N R4W S2O
	TR39
	S29
	1987
	1985

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
39.97	Point for the 1/4 sec. cor. of secs. 20 and 29, determined at a calculated position from Bureau of Reclamation sta. 100+80.00 R.O.W. 175 FT. RT. using the Reclamation's field data.
	From this point the 1985 monument, bears S 21°45' E, 3 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, flush with the ground, remark the brass cap to read.
	T4N R4W
	$1/4 \frac{S20}{S29}$
	1987
	1987
	Deposit the same magnet in a 1 x 1 x 2 5/8 in. white colored plastic case beneath the stainless steel post.
	A steel fence post is near the cor.
	From this same point the Bureau of Reclamation right-of-way marker, bears S 52°45' E, 1.730 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. R.O.W. 175 FT. RT. P.O.S.T. 752 + 90.20 R-7. The marks 100+80.00 are crossed out.
	S 89°55' W, beginning new measurement.
33.44	Point for a witness point on the northerly right-of-way line of the C.A.P. Canal determined by the position of the witness point set in 1985.
	From this point the 1985 monument, bears S 21°43' W, 1.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.
l	I

Corrective Dependent Resurvey of a Portion of the Subdivisional Lines,

CHAINS	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
	W P
	T4N R4W
	\$20
	TR39
	S29 /
	1987
	1985
	Deposit the same magnet in a 1 \times 1 \times 2 5/8 in. white colored plastic case beneath the stainless steel post.
	A steel fence post is near the cor.
39.97	The cor. of secs. 19, 20, 29, and 30.
	Corrective Subdivision of Section 13, T 4 N, R 4 W, Gila and Salt River Mer., Arizona
	Correction of a Portion of the Survey
	executed by Paul L. Reeves and Stephen J. Malloy in 1985-86
	From the 1/4 sec. cor. of secs. 13 and 24.
	North, on the N and S center line of sec. 13.
9.415	AP 3A, Tract 37, on the southerly right-of-way line of the C.A. Canal, hereinafter described.
	Continue on the N and S center line of sec. 13, on line $3A-2$, Tract 37.
22.385	AP 2, Tract 37, on the northerly right-of-way line of the C.A.P Canal, hereinafter described.
	Continue on the N and S center line of sec. 13.

Corrective Subdivision of Section 13,

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	2 2 11 11 2 11 7 22 11 11 11 11 11 11 11 11 11 11 11 11
40.015	The center 1/4 sec. cor. of sec. 13, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, with brass cap mkd.
	T4N R4W
	C 1/4 S13
	1985
	Corrective Subdivision of Section 21, T 4 N, R 4 W, Gila and Salt River Mer., Arizona
	Correction of a Portion of the Survey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86.
	From the 1/4 sec. cor. of secs. 21 and 28, monumented with an iron post, 1 in. diam., firmly set, projecting 24 ins. above ground, with brass cap mkd.
	S21
	$1/4 \frac{S21}{S28}$
	1916
	N 0°04' W, on the N and S center line of sec. 21.
10.005	The center S-S 1/64 sec. cor. of sec. 21, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	\$21
	C-S-S
	1/64
	1985
20.01	The center S 1/16 sec. cor. of sec. 21, monumented with a
20002	stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	С
	C S 1/16 S21
	Č 1985
	1965

Corrective Subdivision of Section 21,

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
40.02	Point for the center 1/4 sec. cor. of sec. 21, at intersection with the E and W center line of sec. 21, occupied by the 1985 monument, a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	T4N R4W C 1/4 S21 1985
45.46	Intersect line 40-41, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented.
	From this point AP 41 bears N 80°02' E, 10.65 chs. dist., monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 41 TR 39 P.C. 171+86.39 R.O.W. 125 FT. RT. R-8.
	From this same point a witness point on line 40-41, Tract 39, bears S 80°02' W, 15.79 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
65.27	Intersect line 12-13, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, point not monumented.
	From this point AP 12 bears S 74°21' E, 6.315 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. A steel fence post is near the cor.
80.04	The 1/4 sec. cor. of secs. 16 and 21, monumented with a deteriorating iron post, 30 ins. long, 1 in. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
	At the cor. point
	Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.
	T4N R4W 1/4 <u>S16</u> 1987

Corrective Subdivision of Section 21, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

T 4 N, R 4 W, Gila and Salt River Mer., Arizona
Deposit a magnet in a 1 \times 1 \times 2 5/8 in. white plastic case beneath the stainless steel post.
Insert the original monument inside the stainless steel post.
From the 1/4 sec. cor. of secs. 21 and 22, monumented with an iron post, 1 in. diam., firmly set, projecting 15 ins. above ground, with brass cap mkd.
1/4 S21 S22 1916
S 89°59' W, on the E and W center line of sec. 21.
The center E 1/16 sec. cor. of sec. 21, monumented with a stainless steel post, 2 1/2 in. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
C E 1/16 S 21 1985
The center 1/4 sec. cor. of sec. 21.
Intersect line 40-41, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented; from this point AP 40 bears S 80°02' W, 6.57 chs. dist., hereinafter described.
The true point for the 1/4 sec. cor. of secs. 20 and 21.
Corrective Subdivision of Section 29, T 4 N, R 4 W, Gila and Salt River Mer., Arizona
Correction of the Survey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86.
From the 1/4 sec. cor. of secs. 29 and 32, monumented with an iron post, 1 in. diam., firmly set, projecting 18 ins. above ground, with brass cap mkd.

Corrective Subdivision of Section 29, T 4 N. R 4 W. Gila and Salt River Mer., Arizona

<u></u>	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	1/4 <u>S29</u> 332 1916
	The cor. is located in a fence, bears N and S.
i	N 0°02' E, on the N and S center line of sec. 29.
	Along fence.
40.07	Point for the center 1/4 sec. cor. of sec. 29, at intersection with the E and W center line of sec. 29.
	From this point the 1985 monument, bears S 41°00' E, 1 lk. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.
	T4N R4W
	C1/4 S29
	1987 1985
1	1903
4	Deposit the same magnet in a $1 \times 1 \times 2 = 5/8$ in. white colored plastic case beneath the stainless steel post.
	The cor. is located on W side of a fence, bears N and S.
61.56	Intersect line 36-37, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented.
	From this point AP 37, bears N 82°17' E, 4 lks. dist., monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 37 TR 39 R.O.W. 1200 FT. RT. 751+44.10 R-7.
	From this same point AP 36, bears S 82°17' W, 21.90 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
80.12	The 1/4 sec. cor. of secs. 20 and 29.

Corrective Subdivision of Section 29, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

From the 1/4 sec. cor. of secs. 28 and 29, monumented with an iron post, 1 in. diam., firmly set, projecting 15 ins. above ground, with brass cap mkd. 1/4 S29 S28 1916 S 89°56' W, on the E and W center line of sec. 29. The center 1/4 sec. cor. of sec. 29. Intersect line 35-36, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line southerly right-of-way line of the C.A.P. Canal bears, S 34°55' W, 9.335 chs. dist., hereinbefore described.
iron post, 1 in. diam., firmly set, projecting 15 ins. above ground, with brass cap mkd. 1/4 S29 S28 1916 S 89°56' W, on the E and W center line of sec. 29. The center 1/4 sec. cor. of sec. 29. Intersect line 35-36, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line of the C.A.P. Canal bears,
S29 S28 1916 S 89°56' W, on the E and W center line of sec. 29. The center 1/4 sec. cor. of sec. 29. Intersect line 35-36, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line of the C.A.P. Canal bears,
The center 1/4 sec. cor. of sec. 29. Intersect line 35-36, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line of the C.A.P. Canal bears,
Intersect line 35-36, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line of the C.A.P. Canal bears,
line of the C.A.P. Canal, point not monumented. From this point a witness point on line bet. secs. 29 and 30, on the southerly right-of-way line of the C.A.P. Canal bears,
the southerly right-of-way line of the C.A.P. Canal bears,
From this same point, AP 36, Tract 39, bears N 34°55' E, 22.675 chs. dist., hereinbefore described.
The 1/4 sec. cor. of secs. 29 and 30.
Corrective Survey of Tract 37, T 4 N, R 4 W, Gila and Salt River Mer., Arizona
Correction of the Survey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86
Beginning at AP 1, Tract 37, on the northerly right-of-way line of the C.A.P. Canal, on line bet. secs. 13 and 18, Tps. 4 N, Rs. 3 and 4 W, monumented with a stainless steel post, 2 1/2 ins diam., firmly set, projecting 4 ins. above ground, with brass cankd.
T4N R4W R3W S13 S18 AP1 TR37
B 0 R

Corrective Survey of Tract 37, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	The cor. is located at corner of fences extending N, N 69° E and S 69° W.
	From this cor. the 1/4 sec. cor. of secs. 13 and 18, on the E bdy. of the Tp., bears N 0°01' E, 2.32 chs. dist., hereinbefore described.
	S 69°04' W, on line 1-2, Tract 37, on the northerly right-of-way line of the C.A.P. Canal.
	Along fence.
42.86	AP 2, Tract 37, at intersection with the N and S center line of sec. 13, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 1 in. above ground, with brass cap mkd.
	T4N R4W
	S13
	AP2
	TR37
	1985
	A stool forgo post is noon the son
	A steel fence post is near the cor.
	The cor. is located on N side of a fence, bears N 69° E and S 69° W.
	From this cor. a local monument, a rebar, 1/2 in. diam., projecting 1 in. above ground, bears N 66°00' W, 0.7 lk. dist.
	SOUTH, on line 2-3A, Tract 37, on a portion of the N and S center line of sec. 13.
12.97	AP 3A, Tract 37, at intersection with the southerly right-of-way line of the C.A.P. Canal, monumented with a rebar, 17 ins. long, 1/2 in. diam., flush with the ground, with attached plastic cap mkd. R.L. FANNIN LS 14177.
	From this point AP 3, monumented in 1985, bears N 7°00' W, 6 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.

Corrective Survey of Tract 37,
T 4 N. R 4 W. Gila and Salt River Mer. Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	T4N R4W TR37 AP3A S13 1987 1985
	Deposit the same magnet in a 1 x 1 x 2 5/8 in. white colored plastic case beneath the stainless steel post.
	Reset the rebar alongside the stainless steel post.
	A steel fence post is near the cor.
	The cor. is located on S side of a fence, bears N 69° E and S 69° W.
	From this cor. a Bureau of Reclamation right-of-way marker, bears S 69°04' W, 7.895 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 320+00.06 R.O.W. 400 FT. RT. R-8.
	N 69°04' E, on line 3A-4A, Tract 37, on the southerly right-of-way line of the C.A.P. Canal.
	Along fence.
3.34	A local monument, a rebar, 1/2 in. diam., projecting 1 in. above ground.
7.97	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 330+47.11 R.O.W. 400 FT. RT. R-8.
22.41	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 340+00.02 R.O.W. 400 FT. RT. R-8.
37.56	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 349+99.97 R.O.W. 400 FT. RT. R-8.

Corrective Survey of Tract 37,

<u></u>	T 4 N, R 4 W, Gila and Salt River Mer., Arizona			
CHAINS				
42.86	AP 4A, Tract 37, at intersection with the line bet. secs. 13 and 18 The 4 N Rs 3 and 4 W monumented with a rebar 18 ins			
	18, Tps. 4 N, Rs. 3 and 4 W, monumented with a rebar, 18 ins long, 1/2 in. diam., projecting 2 ins. above ground.			
	From this point AP 4, monumented in 1985, bears S 86°30' W, 8.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.			
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.			
	T4N			
	R4W R3W TR37			
	AP4A S18			
	\$13			
	1987			
	1985			
	Deposit the same magnet in a 1 x 1 x 2 5/8 in. white colored plastic case beneath the stainless steel post.			
	Insert the rebar inside the stainless steel post.			
	The cor. is located 2 lks. S of corner of fences extending N 69° E, S 69° W and S.			
	From this cor. a Bureau of Reclamation right-of-way marker, bears N 69°04' E, 9.855 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 360+00.12 R.O.W. 400 FT. RT. R-8.			
	N 0°01' E, on line 4A-1, Tract 37, on a portion of the line bet. secs. 13 and 18, Tps. 4 N, Rs. 3 and 4 W.			
12.97	AP 1, Tract 37, and place of beginning.			

Corrective Survey of Tract 38, T 4 N, R 4 W, Gila and Salt River Mer., Arizona


CHAINS

Correction of the Survey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86

Beginning at the point for AP 1A, Tract 38, determined at intersection of the line bet. secs. 13 and 24, with the southerly right-of-way line of the C.A.P. Canal.

From this point AP 1, monumented in 1985, bears S 84°30' E, 13.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set 12 ins. below the surface of a trail road.

Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 26 ins. in the ground, remark the brass cap to read.

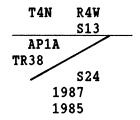

Deposit the same magnet in a 1 x 1 x 2 5/8 in. white colored plastic case beneath the stainless steel post.

A local monument, a rebar, 1/2 in. diam., projecting 2 in. above ground, with attached plastic cap mkd. R.L. FANNIN LS 14177 is NE of cor. After consulting with Fannin, the rebar is reset alongside the stainless steel post.

A steel fence post is near the cor.

The cor. is located on S side of a fence, bears N 69° E and S 69° W.

From this cor. a Bureau of Reclamation right-of-way marker, bears N 69°04' E, 3.32 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 309+99.98 R.O.W. 400 FT. RT. R-8.

From this same cor. a local monument, a rebar, 1/2 in. diam., projecting 1 in. above ground, bears N 79°30' E, 5.0 lks. dist.

From this same cor. the 1/4 sec. cor. of secs. 13 and 24, bears N 89°59' E, 24.625 chs. dist., hereinbefore described.

Corrective Survey of Tract 38, 4 N. R 4 W. Gila and Salt River Mer., Arizona

F	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	S 89°59' W, on line 1A-2A, Tract 38, on a portion of the line bet. secs. 13 and 24.
15.375	True point for AP 2A, Tract 38, identical with the true point for the cor. of secs. 13, 14, 23, and 24, hereinbefore described.
	S 0°01' E, on line 2A-3A, Tract 38, on a portion of the line bet. secs. 23 and 24.
4.255	Intersect a line bet. Bureau of Reclamation markers, point not monumented. See note on page 5.
	From this point Bureau of Reclamation marker 300+00.39 R.O.W. 300 FT. RT. R-8, a brass tablet, 3 3/4 ins. diam., bears N 69°04' E, 4.06 chs. dist., hereinbefore described on page 5. The monument is located S 45° W, 1 1/2 lks. dist., from corner of fences extending S 21° E and S 69° W.
	From this same point a Bureau of Reclamation marker, bears S 69°04' W, 11.10 chs. dist., monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 289+99.82 R.O.W. 300 FT. RT. R-8.
	NOTE: These monuments were not accepted for the purpose of defining Tract 38 because they are in conflict with the map furnished by the Bureau of Reclamation for what they claim as the right-of-way.
5.88	Point for AP 3A, Tract 38, on the southerly right-of-way line of the C.A.P. Canal, determined by the position of AP 3 set in 1985.
	From this point AP 3 monumented in 1985, bears N 69°04' E, 9.5 lks. dist., a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground.
	Remove the stainless steel post, 28 ins. long, from the found position and reset it at the correct position, 24 ins. in the ground, remark the brass cap to read.
	T4N R4W
	AP3A TR38
	S23 S24 1987 1985

Corrective Survey of Tract 38, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

	1 2 N, N 2 W, GIIG GNU SAIC RIVEL MEL., ALIZONA	
CHAINS		
	Deposit the same magnet in a $1 \times 1 \times 2 5/8$ in. white colored plastic case beneath the stainless steel post.	
	A steel fence post is near the cor.	
	From this cor. a local monument, a rebar, 1/2 in. diam., projecting 1 in. above ground, bears S 20°00' E, 1.2 lks. dist.	
:	N 69°04' E, on line 3A-1A, Tract 38, on the southerly right-of-way line of the C.A.P. Canal.	
4.635	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 300+00.39 R.O.W. 400 FT. RT. R-8. The monument is located S 15° W, 2 lks. dist., from corner of fences extending N 69° E and N 21° W.	
	Along fence.	
16.46	AP 1A, Tract 38, and place of beginning.	
	Corrective Survey of a Portion of Tract 39, T 4 N, R 4 W, Gila and Salt River Mer., Arizona	
	Correction of a Portion of the Survey executed by Paul L. Reeves and Stephen J. Malloy in 1985-86	
	From AP 14, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, on line bet. secs. 20 and 21, hereinbefore described.	
	S 0°03' E, on line 14-15A, Tract 39, on the northerly right-of-way line of the C.A.P. Canal, on a portion of the line bet. secs. 20 and 21.	
26.935	AP 15A, Tract 39, hereinbefore described.	

Corrective Survey of a Portion of Tract 39, T 4 N. R 4 W. Gila and Salt River Mer. Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	From a Bureau of Reclamation right-of-marker, on the northerly right-of-way line of the C.A.P. Canal, monumented with a rebar, 1/2 in. diam., projecting 5 ins. above ground, with attached aluminum cap mkd. W.P.R.S. B.O.L. H.R.R. 2-1 1980.
	S 21°43' W, on a portion of line 18-19, Tract 39, on the northerly right-of-way line of the C.A.P. Canal.
7.815	A witness point on the line bet. secs. 20 and 29, hereinbefore described; from this 1987 point the cor. of secs. 19, 20, 29, and 30, bears S 89°55' W, 6.53 chs. dist.
10.805	AP 19, Tract 39, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd.
	T4N R4W S29 AP19 TR39
	1985
	A steel fence post is near the cor.
	From a Bureau of Reclamation right-of-way marker, on the northerly right-of-way line of the C.A.P. Canal, monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. STA 727+14.41 R.O.W. 200.00 LT. B.O.L. H.R.R.L2 1980.
	S 34°55' W, on a portion of line 19-20, Tract 39, on the northerly right-of-way line of the C.A.P. Canal.
2.235	A witness point on the line bet. secs. 29 and 30, located S 0°05' W, 10.565 chs. dist. from the cor. of secs. 19, 20, 29, and 30, hereinbefore described
6.195	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. STA 723+05.45 R.O.W. 200.00 LT.

Corrective Survey of a Portion of Tract 39, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	From a Bureau of Reclamation right-of-way marker, on the northerly right-of-way line of the C.A.P. Canal, monumented with a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. STA 669+30.43 R.O.W. 200.00 LT. S 7°11' W, on a portion of line 25-26, Tract 39, on the northerly
	right-of-way line of the C.A.P. Canal.
0.28	A witness point on the line bet. secs. 30 and 31, located N 89°57' W, 10.545 chs. dist. from the 1/4 sec. cor. of secs. 30 and 31, hereinbefore described.
2.47	AP 26, Tract 39, monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 26 TR 39 STA P.T.667+67.30 R.O.W. 200.00 LT.
	From AP 33, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, monumented with an aluminum finned post, 3/4 in. diam., firmly set, projecting 8 ins. above ground, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W.
	N 7°11' E, on line 33-34, Tract 39, on the southerly right-of-way line of the C.A.P. Canal.
8.455	A witness point on the line bet. secs. 30 and 31, located S 89°52' E, 3.96 chs. dist. from the 1/4 sec. cor. of secs. 30 and 31, hereinbefore described.
12.12	AP 34, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, monumented with an aluminum finned post, 3/4 in. diam., firmly set, projecting 5 ins. above ground, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. A steel fence post is near the cor.
	From AP 38, Tract 39, on the southerly right-of-way line of the C.A.P. Canal, monumented with an aluminum finned post, 3/4 in. diam., firmly set, projecting 6 ins. above ground, with cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. A steel fence post is near the cor.

Corrective Survey of a Portion of Tract 39, T 4 N. R 4 W. Gila and Salt River Mer.. Arizona

	T 4 N, R 4 W, Gila and Salt River Mer., Arizona
CHAINS	
	N 44°08' E, on a portion of line 38-39, Tract 39, on the southerly right-of-way line of the C.A.P. Canal.
1.91	Fence, bears S 4 1/2° W and N 4 1/2° E, 2 lks. dist., thence N 44° E.
1.96	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. R.O.W. 175 FT. RT. P.O.S.T. 752+90.20 R-7.
3.42	A witness point on the line bet. secs. 20 and 29, located East, 2.39 chs. dist. from the 1/4 sec. cor. of secs. 20 and 29, hereinbefore described.
3.78	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 754+10.21 R-7 BK = 102+00.00 R-8 AHD. R.O.W. 175 FT. RT.
12.87	A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 107+99.87 R.O.W. 175 FT. RT. R-8.
	From AP 39, Tract 39, monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 39 TR 39 P.C. 133+70.02 R.O.W. 175 FT. RT. R-8.
	N 56°37' E, on line 39-40, Tract 39, on the southerly right-of-way line of the C.A.P. Canal.
	Along fence.
4.63	A witness point on the line bet. secs. 20 and 21, located S 0°02' E, 2.74 chs. dist. from the true point for the 1/4 sec. cor. of secs. 20 and 21, hereinbefore described.
7.545	AP 40, Tract 39, monumented with a Bureau of Reclamation brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. AP 40 TR 39 P.T. 139+68.18 R.O.W. 125 FT. RT. R-8.

Corrective Survey of a Portion of Tract 39, T 4 N, R 4 W, Gila and Salt River Mer., Arizona

N 80°02' E, on a portion of line 40-41, Tract 39, on the northerly right-of-way line of the C.A.P. Canal. Along fence. 6.57 Intersect the E and W center line of sec. 21, point not monumented; from this point the true point for the 1/4 sec. cor. of secs. 20 and 21, bears S 89°59' W, 8.91 chs. dist. 9.575 A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 146+00.17 R.O.W. 125 FT. RT. R-8. From this marker the witness point on line 40-41, Tract 39, bears N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level. Access is by way of improved and unimproved roads.
northerly right-of-way line of the C.A.P. Canal. Along fence. Intersect the E and W center line of sec. 21, point not monumented; from this point the true point for the 1/4 sec. cor. of secs. 20 and 21, bears S 89°59' W, 8.91 chs. dist. 9.575 A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 146+00.17 R.O.W. 125 FT. RT. R-8. From this marker the witness point on line 40-41, Tract 39, bears N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
Intersect the E and W center line of sec. 21, point not monumented; from this point the true point for the 1/4 sec. cor. of secs. 20 and 21, bears S 89°59' W, 8.91 chs. dist. 9.575 A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 146+00.17 R.O.W. 125 FT. RT. R-8. From this marker the witness point on line 40-41, Tract 39, bears N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. 30.225 AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,550 ft. above sea level.
monumented; from this point the true point for the 1/4 sec. cor. of secs. 20 and 21, bears \$ 89°59' W, 8.91 chs. dist. 9.575 A Bureau of Reclamation right-of-way marker, a brass tablet, 3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 146+00.17 R.O.W. 125 FT. RT. R-8. From this marker the witness point on line 40-41, Tract 39, bears N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. 30.225 AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
3 3/4 ins. diam., seated in concrete, flush with the ground, with top mkd. 146+00.17 R.O.W. 125 FT. RT. R-8. From this marker the witness point on line 40-41, Tract 39, bears N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
N 80°02' E, 12.745 chs. dist., monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. as described in the official record of the 1985-86 dependent resurvey of T 4 N, R 4 W. From AP 47A, Tract 39. N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
N 0°01' W, on line 47A-1, Tract 39, on a portion of the line bet. secs. 22 and 23. 30.225 AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
secs. 22 and 23. AP 1, Tract 39. GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
GENERAL DESCRIPTION The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
The land encompassed in this corrective survey is located about 8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.
8 miles SW of Luke Air Force Auxiliary Field No. 1 and is nearly level to gently rolling desert land covered mostly with creosote and varies from about 1,400 ft. to 1,560 ft. above sea level.

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FIELD ASSISTANTS

NAMES	CAPACITY	
Dean E. Mac Donald	Cadastral Surveyor	
Robert M. Charboneau	Surveying Technician	
Rebecca Ramirez	Surveying Aid	

CERTIFICATE OF SURVEY

We, Duane R. Garoutte and Paul L. Reeves, Cadastral Surveyors, HEREBY CERTIFY upon honor that, in pursuance of special instructions bearing date of the 8th day of November, 1985, supplemental special instructions dated November 25, 1986, and second supplemental special instructions dated December 19, 1986, We have made a corrective dependent resurvey of a portion of the east boundary and subdivisional lines and a corrective survey of subdivisions in sections 13, 21 and 29 and a corrective metes-and-bounds survey of Tracts 37 and 38 and a portion of Tract 39 of Township 4 North, Range 4 West, of the Gila and Salt River Meridian, in the State of Arizona which are represented in the foregoing field notes as having been executed by us and under our direction; and that said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

Jan. 3, 1989 (Date)	Cadastral Surveyor)
<u> </u>	Paul L. Rewa (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT Arizona State Office Phoenix, Arizona

The foregoing field notes of the corrective dependent resurvey of a portion of the east boundary and subdivisional lines and the corrective survey of subdivisions in sections 13, 21 and 29 and the corrective metes-and-bounds survey of Tracts 37 and 38 and a portion of Tract 39 of Township 4 North, Range 4 West, Gila and Salt River Meridian, Arizona, executed by Duane R. Garoutte and Paul L. Reeves, Cadastral Surveyors, having been critically examined and found correct, are hereby approved.

(Date)

CERTIFICATE OF TRANSCRIPT

I Certify that the foregoing transcript of the field notes of the above-described surveys in T 4 N, R 4 W, Gila and Salt River Meridian, Arizona is a true copy of the original field notes.

(Date) (Chief Cadastral Surveyor of Arizona)